



Premium High Cut System Process Chart

For All Paint Systems (including the very latest energy or 'hyper' clearcoats)

Remove Defect



Inspect defect



Remove defect - P1500

Stage 1: CUT

Stage 2: FINISH (if desired)





G3 Premium
Abrasive Compound

1
Stage 1:
CUT

Product Size	Codes
500g	G3P506
1kg	G3P101

Applicators

G Mop 6" High Cut Foam
G Mop 8" High Cut Foam

Codes
GMC618
GMC818





G3 Premium
Abrasive Compound

2
Stage 2:
FINISH

Product Size	Codes
500g	G3P506
1kg	G3P101

Applicators

G Mop 3" Finishing Foam
G Mop 6" Finishing Foam
G Mop 8" Finishing Foam

Codes
GMF301
GMF601
GMF801

Stage 1: CUT



1
ATTACH

Attach a G Mop Back Plate and a G Mop High Cut Foam to a polisher



2
SHAKE

Shake bottle well before use



3
POUR

Dispense a small quantity of product onto surface or pad



4
900 - 1300rpm

Compound at **LOW SPEED**



5

Wipe clean with a Finishing Cloth **FC-3** (3 x cloths)

Tip: Prior to first use of a new pad, roughen with a Spurring Brush (**1090005**) to ensure optimum results. Clean pad with the Spurring Brush after use.

Stage 2: FINISH (if desired on darker colours)

If swirl marks or holograms remain, use the same process as in Stage 1: **CUT** but with a G Mop Finishing Foam and a small quantity of G3 Premium at 800 - 1100rpm.

Applicator Back Plates

G Mop Flexible Back Plate for 6" Pads
GMB146 (14mm thread size)
GMB586 (5/8" thread size)
GMB166 (16mm thread size)

G Mop Flexible Back Plate for 8" Pads
GMB814 (14mm thread size)
GMB858 (5/8" thread size)
GMB816 (16mm thread size)



Stage 3: PROTECT





G3 Glaze
Gloss Enhancer

3
Stage 3:
PROTECT

Product Size	Codes
500ml	G3G501
1 ltr	G3G101
1 US gallon	G3G118





G3 Wax
Premium Liquid Protection

3
Stage 3:
PROTECT

Product Size	Codes
500ml	G3W501
1 ltr	G3W106
1 US gallon	G3W118

OR

Applicators for both products

G Mop 3" Finishing Foam
G Mop 6" Finishing Foam
G Mop 8" Finishing Foam
Finishing Cloth (3 x cloths)

Codes
GMF301
GMF601
GMF801
FC-3

Stage 3: PROTECT - G3 Glaze (for fresh paint)



1
ATTACH

Attach a G Mop Back Plate and a G Mop Finishing Foam to a polisher



2
SHAKE
POUR

Shake bottle well and apply a small quantity to the pad



3
800 - 1100rpm

Polish at 800 - 1100rpm



4

Wipe clean with a Finishing Cloth **FC-3** (3 x cloths)

Stage 3: PROTECT - G3 Wax (for fully cured paint)



1
SHAKE
POUR

Shake bottle well and apply a small quantity to the surface or cloth



2

Rub the product in a circular motion onto the surface



3

Allow to dry to a haze



4

Wipe clean with a Finishing Cloth **FC-3** (3 x cloths)